



**avasco  
solar**




**assembly instructions**

# **SolarSpeed **inverse** east-west portrait**



# SolarSpeed components

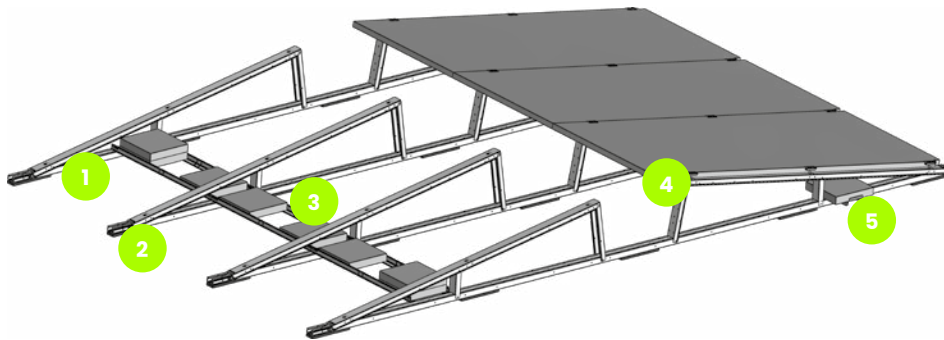

## standard components



1

basic unit:  
semi-assembled triangles  
+ rail + protective rubbers\*  
+ vertical reinforcement




2

end rubber\*



3

set of L-profiles

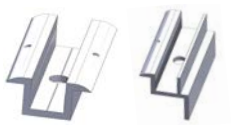

4

clamps + M8 bolts



5

ballast support

## additional components



concrete footing (12kg)  
+ hammer plug



PP footing



C-rail end  
reinforcement



centre piece for  
set of L-profiles



ridge connection











omega bracket

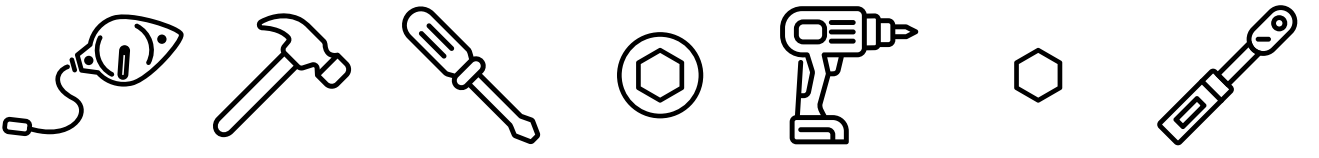\* For PVC roofs use rubber with aluminium underlay.



## required assembly tools

						
chalk line	hammer	screwdriver	socket 3/8" socket SW8	electric tool	hex 6.0	torque wrench range 15-30Nm











Avasco Solar spacer

## prior to assembly

Make sure that the roof surface on which the frame is to be mounted is clean, dry and flat. Contamination such as gravel, sand or pebbles can lead to roof damage or installation instability.

## correct assembly of sheet metal screws

Prescribed compression EPDM washer: 25% of original thickness.  
Use tools with depth control!

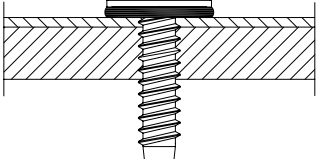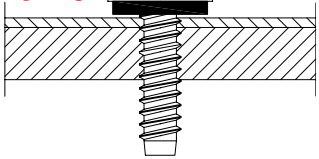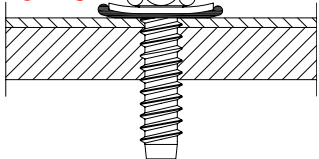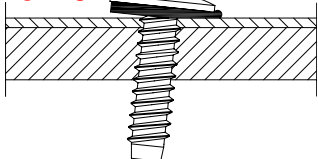			
			
Correctly screwed on	Tightened too loosely	Tightened too far (seal damaged)	Tightened too angled (seal damaged)

Choosing the correct installation tool is absolutely essential for the fastener to drill and tap in the way it has been designed to perform. The selected screw gun will need to be equipped with a variable trigger to deliver a controlled overall speed without end loading, of between 1700 and 2000 rpm. It will need to provide torque of up to 30 Nm allied to a clutch mechanism to ensure that excessive torque and speed is not retained, causing damage or the 'stripping out' the fastener. Socket 3/8" must be used with sheet metal screws, socket SW8 with self-drilling screws.



## step 1: mounting basic units

required components:



SolarSpeed basic unit  
(semi-assembled)



vertical  
reinforcement



C-rail end  
reinforcement  
(optional)




sheet metal screw  
(Ø6.5x19mm)

### step 1.1: from semi-assembled to assembled basic units



Lift the semi-assembled basic unit and bend it until the holes in the top of the triangle are aligned. Squeeze the sides of the short leg to fit them inside the longer leg while bending.

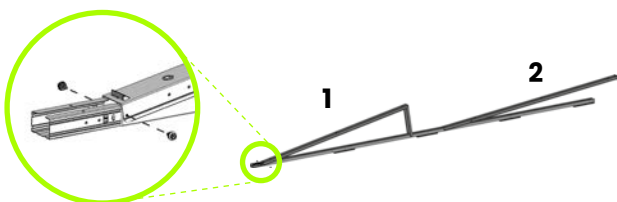

Secure the end of assembly triangle **1** to the rail with 2 sheet metal screws (Ø6.5x 19mm). Do the same with triangle **2** but only after assembling the basic units (step 1.4)




Bend the panel stop in an angle of 90° using a screwdriver.




### step 1.2: securing top of triangles

Secure the top of each assembly triangle with 2 sheet metal screws ( $\text{Ø}6.5 \times 19\text{mm}$ ).

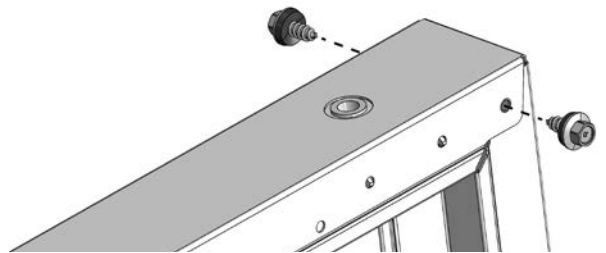

### step 1.3: connecting the basic units


- Place the basic units on a flat and stable roof surface.
- Connect the basic units by sliding the tapered rail end into the rail of the previous basic unit until you hear a clicking sound.
- Secure assembly triangle 2 of the previous basic unit with 2 sheet metal screws ( $\text{Ø}6.5 \times 19\text{mm}$ ).
- Every 30 metres a dilatation must be provided. See step 2.2.

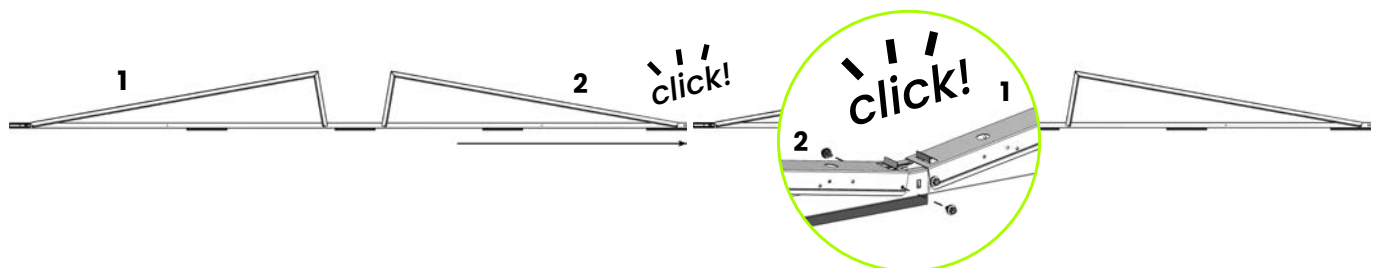

### step 1.4: (optional) installing C-rail end reinforcement


Install the C-rail end reinforcement by sliding it between the assembly triangle and the rail. Secure it with 2 sheet metal screws ( $\text{Ø}6.5 \times 19\text{mm}$ ).

*An indication of the locations can be calculated with our free online calculator. [solarspeed.avasco.be](http://solarspeed.avasco.be).*

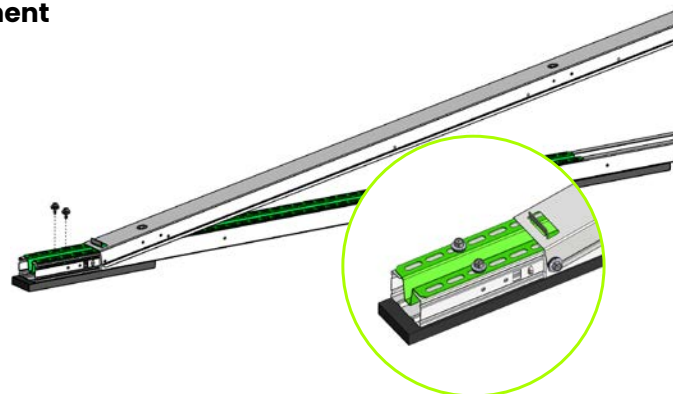

### step 1.5: installing reinforcements

Install the vertical reinforcements in the provided holes with 4 sheet metal screws ( $\text{Ø}6.5 \times 19\text{mm}$ ).

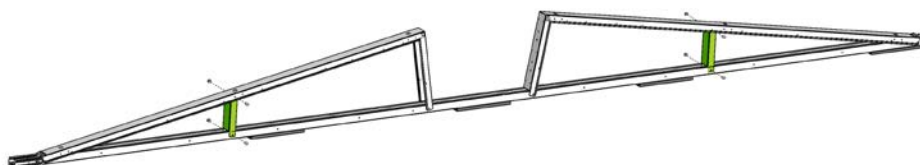



**step 1.6: (optional) installing single East or West facing module.**

required components:



EWE rail



triangle




vertical  
reinforcement



sheet metal screw  
(Ø6.5x19mm)

The triangle is installed in the first or the last hole of the rail as shown in the image below to create an East or West facing basic unit.


Secure the East or West facing basic unit in a similar way as described in the previous steps.

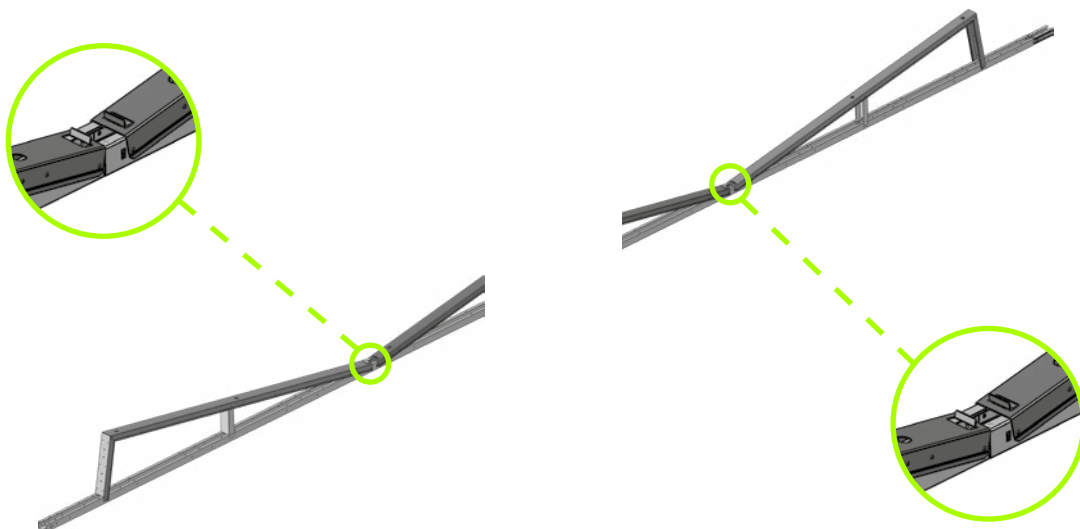



**step 1.7: (optional) installing backplate on the East or West facing module.**

required components:

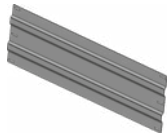


backplate



sheet metal screw (Ø6.5x19mm)

Secure the backplate with 4 sheet metal screws (Ø6.5x19mm) on each East or West facing basic unit.

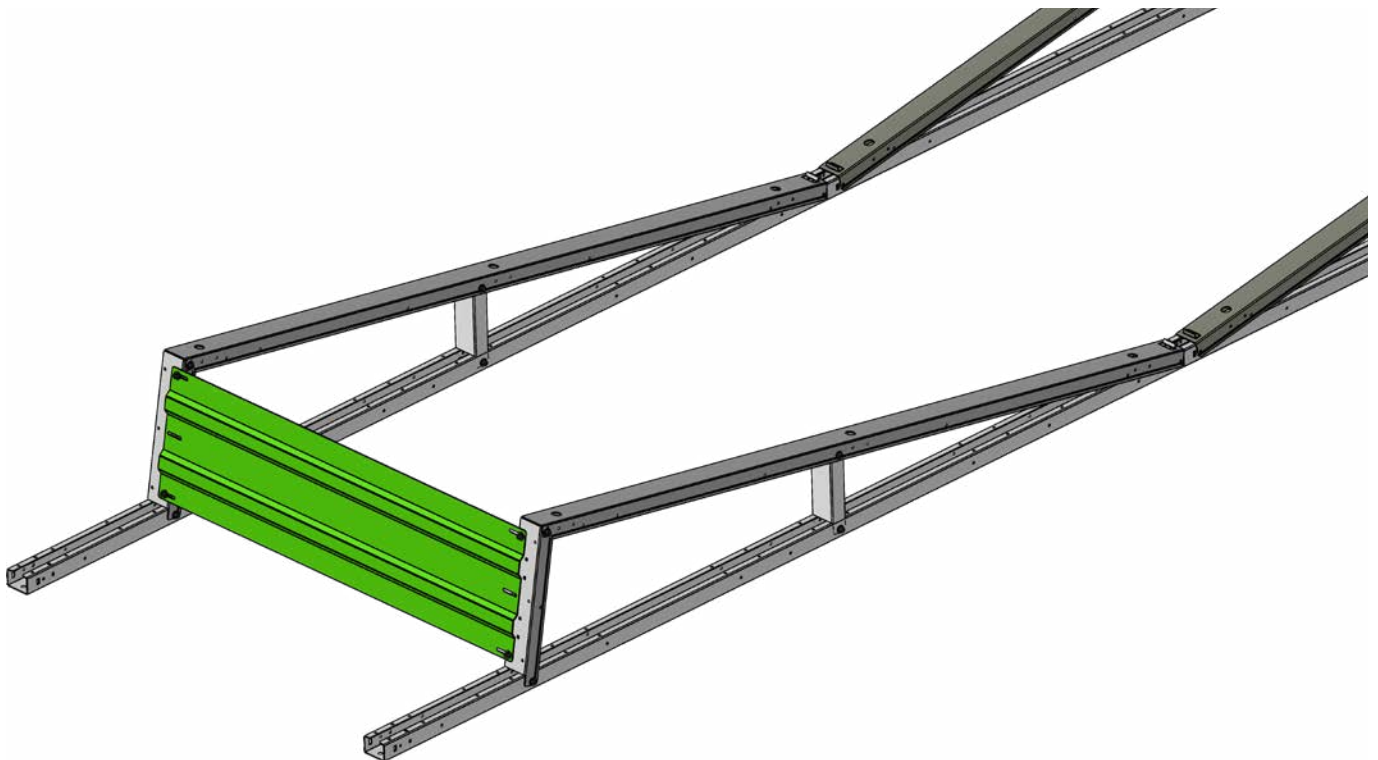



## step 2: aligning the rows

### step 2.1: plotting the rows

required assembly tools:



Avasco Solar spacer



chalk line





#### Tip!

Make a horizontal and vertical mark on the roof using a chalk line. When setting out the markers, respect the minimum edge zones (see general notes).






Align the rows according to plan, taking into account the width of the panels.  
 To easily determine the distance between the basic units, you can use the Avasco Solar spacer.

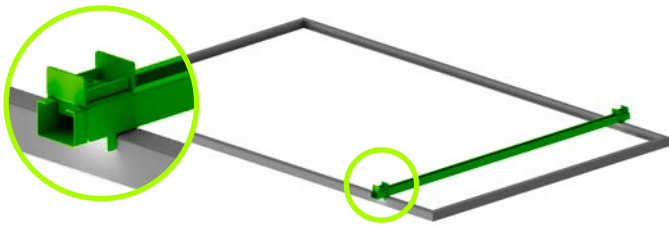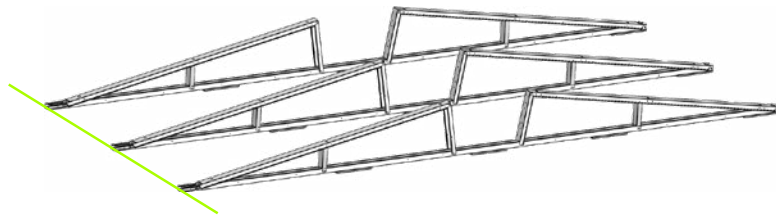

Set the width of the panel on the spacer.

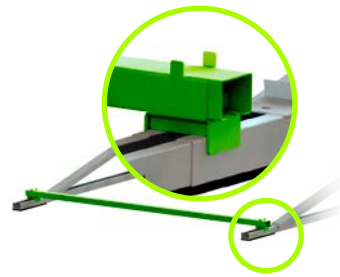


Turn the spacer 180° and align the rows.

**step 2.2: providing dilatations (thermal breaks)**

In the north-south direction, also referred to as the ALU direction, a dilatation must be provided at least once every 26 metres. The distance between these 2 basic units must be at least 300mm to allow the use of ballast supports.

In the east-west direction, also referred to as the steel direction, a dilatation must be provided at least once every 30 metres.

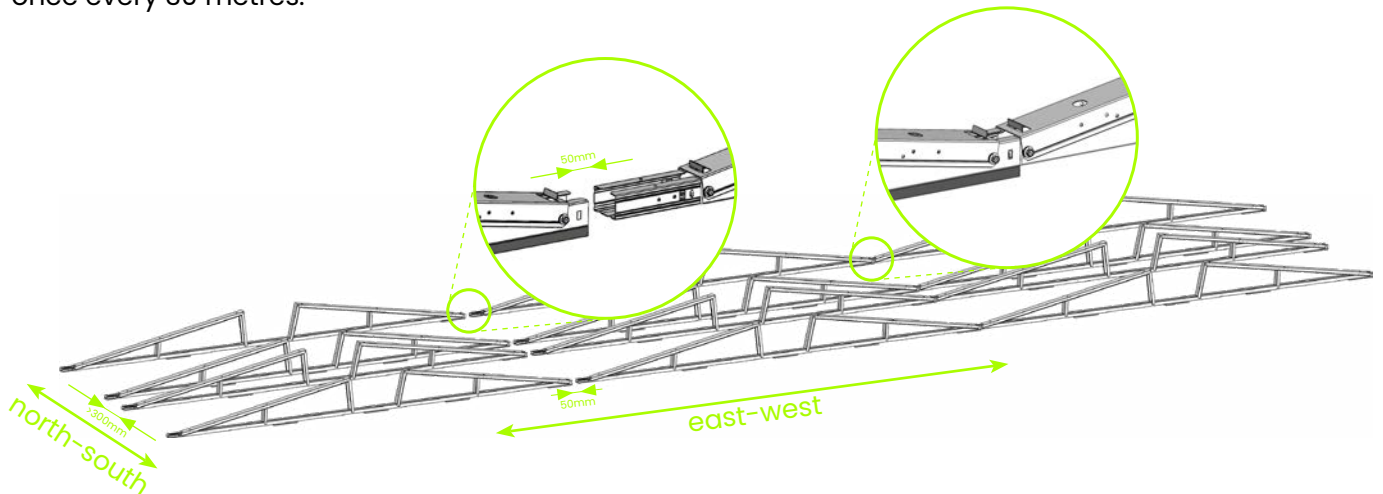



## step 3: attaching footing system

An indication of the required amount of footings and ballast, their locations and the method of footing and ballasting can be calculated with our free online calculator: [solarspeed.avasco.be](http://solarspeed.avasco.be).

Several options are possible:

- Go to step 3.1 for rubbers
- Go to step 3.2 for PP footings
- Go to step 3.3 for concrete footings
- Go to step 3.4 for mounting on metal substructure

### step 3.1 attaching end rubber at the end of the rail

required components:



end rubber




plastic plugs



Push 2 plugs into the holes of the rubbers



Attach the rubbers to the rail by pushing the plugs into the provided holes.

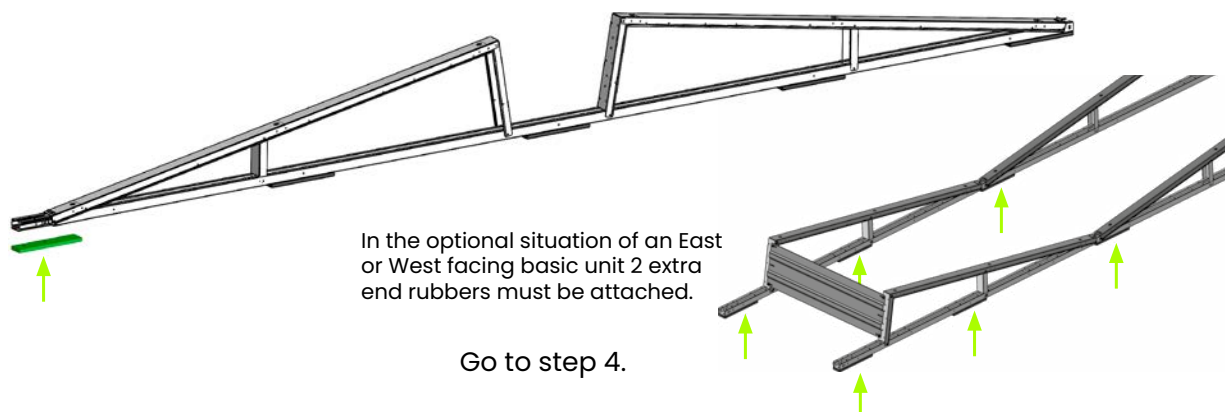



### step 3.2: installing Avasco PP footing

required components:



 
PP footing



sheet metal screw (Ø6.5x19mm)




In the optional situation of an East or West facing basic unit extra PP-footings must be attached.



At least 4 Avasco PP footings are placed under each basic unit. Add one Avasco PP footing at the end of the first rail.

The PP footing can be attached to the basic unit by securing it with 2 sheet metal screws in the provided holes in the rail of the basic unit.

The PP footings are available with or without pre-installed rubbers.

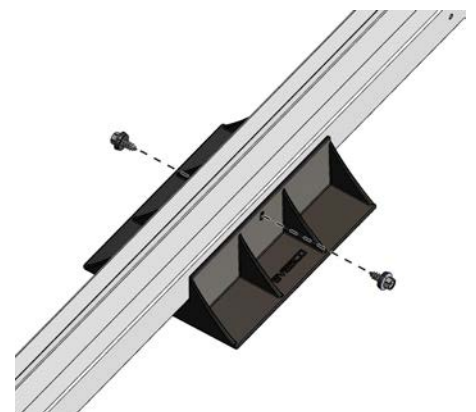

Go to step 4.



### step 3.3: installing Avasco concrete footing

required components:




concrete footing + hammer plug





rubber protection

A concrete footing is placed at the beginning, center and the end of the connected basic units. A rubber is always placed under the concrete footings to protect the roof surface. At least 5mm of rubber must be visible on each side of the concrete footing.

In case of green or pebble roofs, remove the plants or pebbles at the places where the concrete footings need to be installed.

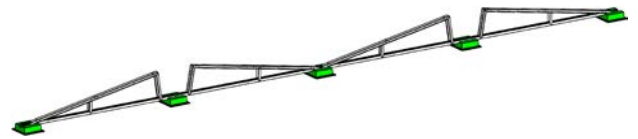

In the optional situation of an East or West facing basic unit an extra concrete footing must be attached.

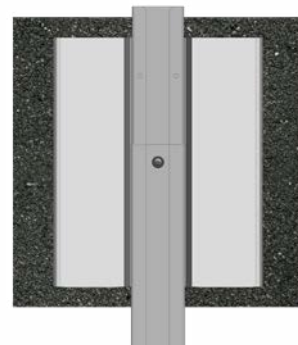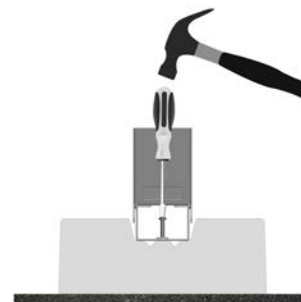

**Caution!** Depending on the required ballast, it may also be necessary to place an extra concrete footing in the center of the basic unit.

Once the concrete footings are correctly positioned, the connected basic units can be attached to them. This is done with hammer plugs HPS-1 R 8/10x40.


The hammer plug is inserted into the provided holes and hammered down. Use a screwdriver as an extension to prevent damage to the basic unit.

Go to step 4.



### step 3.4: installing on metal substructure

required components:




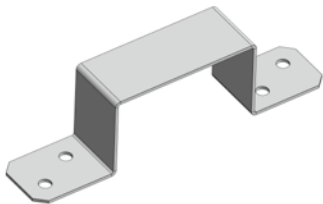


omega bracket



self-drilling screw  
(Ø5.5x25mm)

SolarSpeed can be installed on metal substructure e.g. steeldeck, aluminium or steel profiles, ... This can be done with an omega bracket and 2, 3, 4 or 5 self drilling screws.

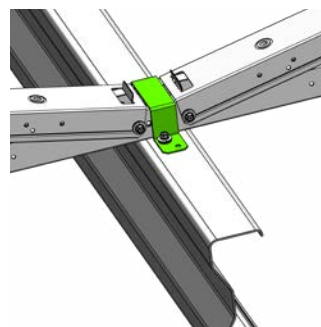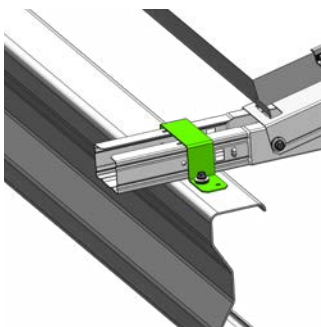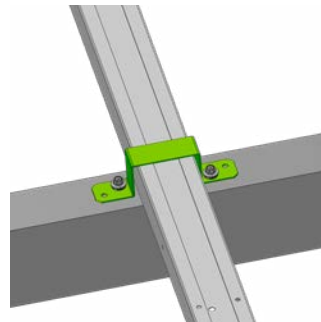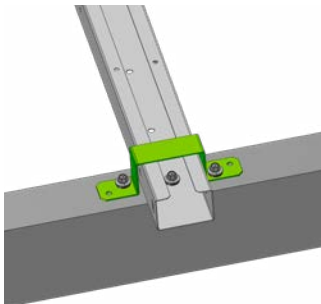

More detailed information can be found in the assembly instructions of the specific metal substructure.



## step 4: placing the ballast

An indication of the required amount of footings and ballast, their locations and the method of footing and ballasting can be calculated with our free online calculator: [solarspeed.avasco.be](https://solarspeed.avasco.be).

### step 4.1: providing ballast with ballast support

required components:




ballast support



ballast tile  
(provided by installer)

On the inside of the installation, the ballast can be placed on ballast supports. These can simply be placed over the rails.

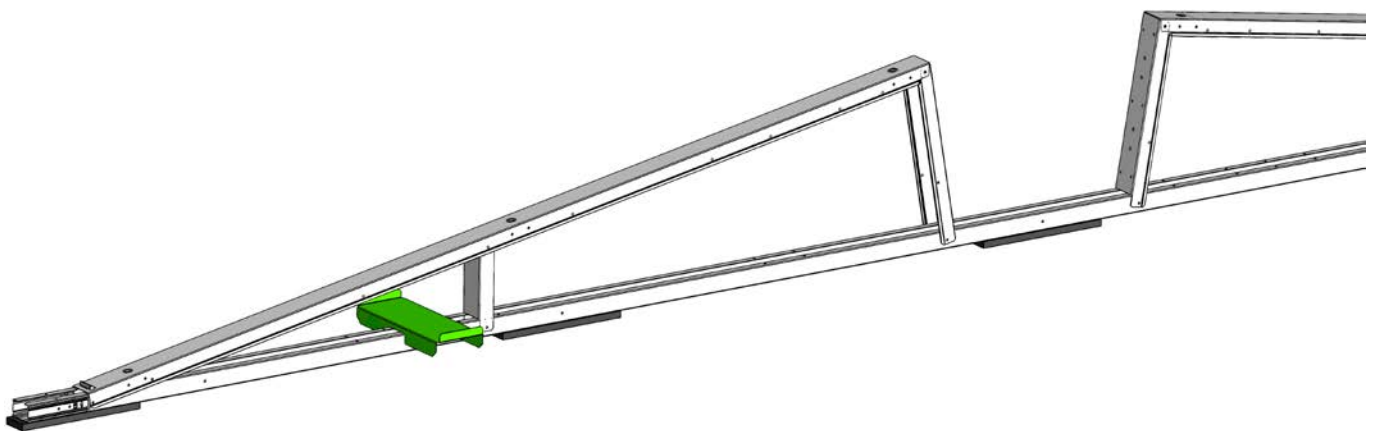



#### step 4.2: providing ballast with L-profiles

required components:



set of L-profiles



centre piece for set of L-profiles (optional)



ballast tile  
(provided by installer)



sheet metal screw  
(Ø6.5x19mm)

On the outer side of the installation ballast is always placed on sets of L-profiles.

The sets of L-profiles must be fixed with 4 sheet metal screws (Ø6.5x19mm) in the pre-drilled holes of the rails of the basic units (together with the optional C-rail end reinforcement).



Each optional C-rail end reinforcement must always be fixed with 4 sheet metal screws (Ø6.5x19mm) together with the L-profiles.

The optional center piece must be placed in the center of the L-profiles set where it can be assembled with 2 sheet metal screws (Ø6.5x19mm) in the pre-drilled holes.

For a set-up on PP footings the center piece must also be placed on a PP footing.

For a set-up on concrete footings a higher center piece is provided.

On the inner side of the installation sets of L-profiles are used when not enough ballast can be placed on ballast supports.

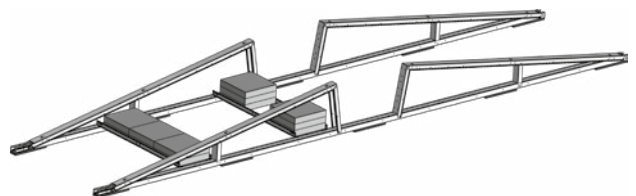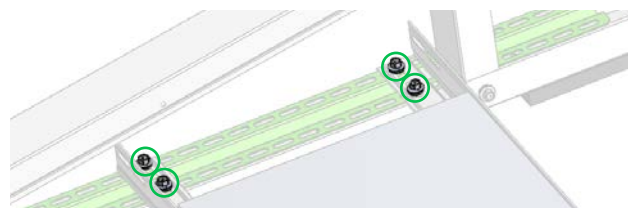




### Step 4.3: (optional) providing ballast with L-profiles on the East or West facing modules

The ballast must primarily be placed at the most outside position possible. Depending on the size of the triangle and thus position of the backplate, this will be

- At the end of the basis unit
- Just at the inside of the triangle

Install the L-profiles in a similar way as described in the previous step.

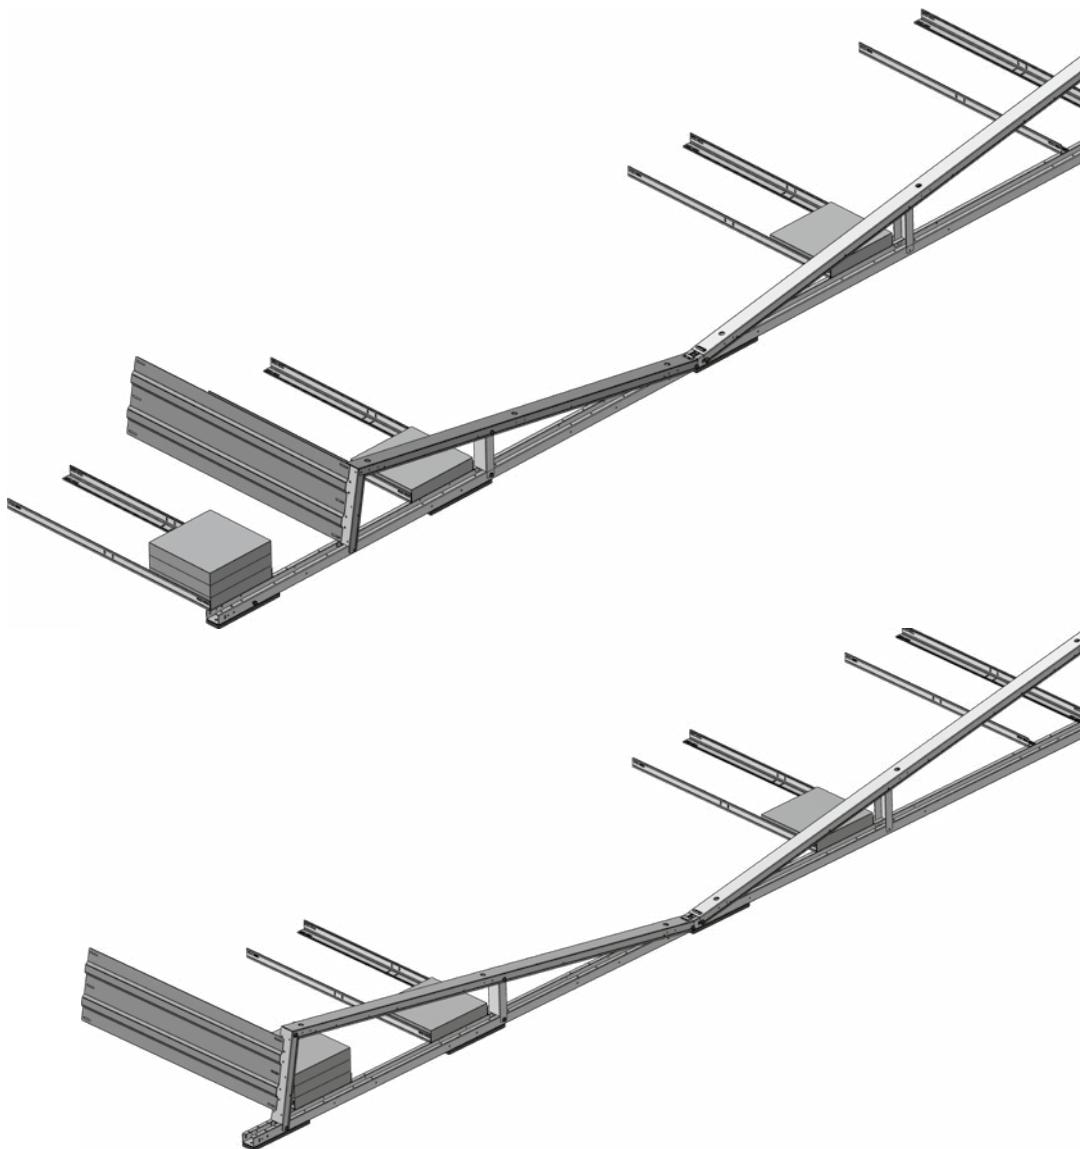






## step 5: installing ridge connection

required components:

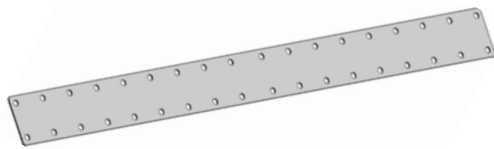


ridge connection



self-drilling screw  
( $\varnothing 5.5 \times 25 \text{mm}$ )


### step 5.1: transverse ridge connections

In the transverse direction, one ridge connection is placed on every basic unit. These are attached on top of both rails. The ridge connection will bend to the appropriate slope when attached to the basic units. Use 4 self-drilling screws ( $\varnothing 5.5 \times 25 \text{mm}$ ) per rail.

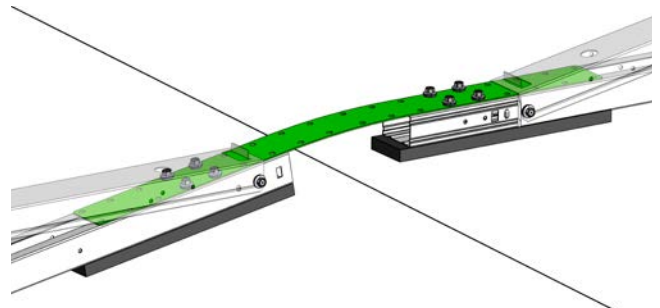

### step 5.2: longitudinal ridge connections

In the longitudinal direction, one ridge connection is placed on every basic unit. These are attached on top of both rails. The ridge connection will bend to the appropriate slope when attached to the basic units. Use 4 self-drilling screws ( $\varnothing 5.5 \times 25 \text{mm}$ ) per rail.

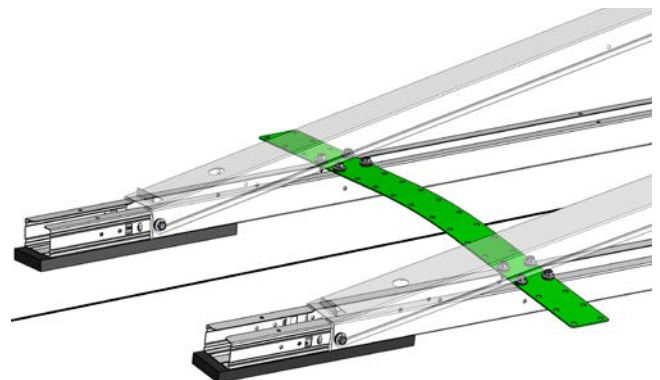




## step 6: ensuring earthing and equipotential bonding

Since the rows are electrically and mechanically interconnected, no additional connections need to be made between the different basic units to provide proper earthing.


However, the individual fields must be connected to each other with an earthing wire. This connection can be made by clamping the insulation-free ends of the wire to the basic unit with a sheet metal screw.

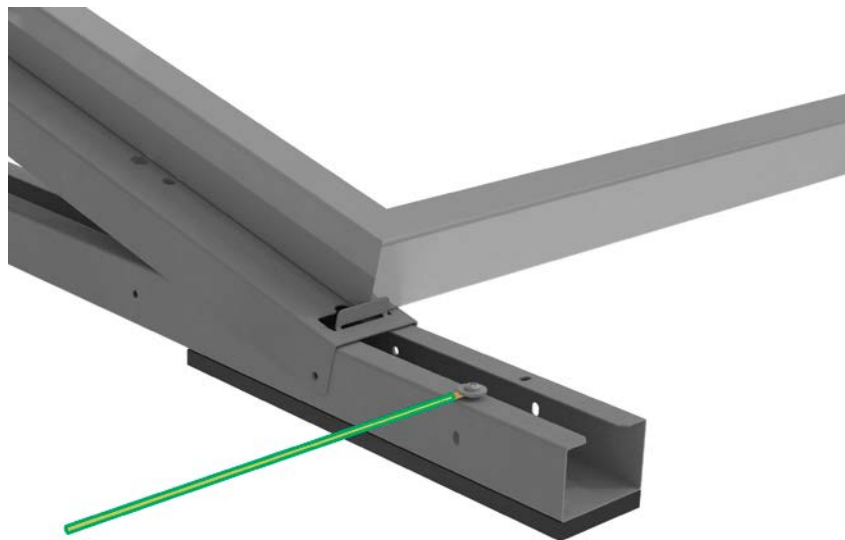



## step 7: assembling the solar panels

required components:

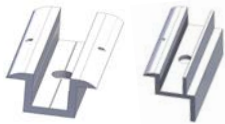


middle and end clamps




M8x55/55 bolt



solar panel  
(provided by installer)

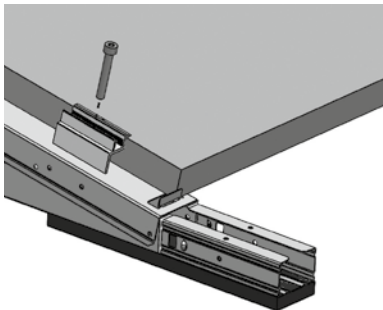

Fix the clamps into the screw thread provided in the assembly triangles with the M8 bolts. Screw the bolts hand tight. After the complete solar module array has been assembled, tighten the bolts with minimum 19Nm and maximum 25Nm. (see general notes)

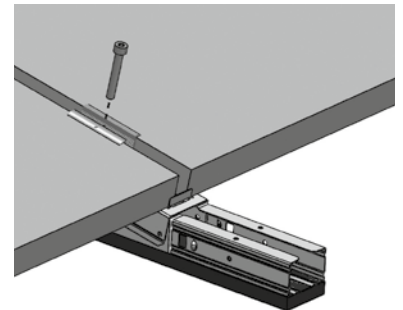



## General notes

- The installer should always check whether the rubber protection is sufficient when installing on soft or semi-soft surfaces. The installer should also check the compatibility of the rubber protection with the roof surface.
- Only use the clamps approved and/or recommended by the module manufacturer. Always tighten the clamping bolt with the correct torque: Minimum 19Nm is required, maximum 25Nm is allowed. A loss of torque is to be expected: At least 13Nm must be measured during inspection after installing.
- In the following situations/circumstances, the mounting frames of Avasco Solar are not suitable, unless written confirmation is provided for a specific project:
  - PVC or TPO roofs with pitches  $> 3^\circ$
  - Bitumen or EPDM roofs with pitches  $> 5^\circ$
  - Places where buildings or other objects can cause a wind tunnel effect or increased wind speeds.
  - Installations closer than 2 km as the crow flies from the coastline.
  - In an aggressive environment: All materials must be in stainless steel with the correct specifications to be determined on the basis of the aggressive substances.
  - In a saline environment: Execution in anodised aluminium or stainless steel.
- Polluted roof surfaces can lead to a lower friction coefficient over time, which means that more ballast or (extra) mechanical connections must be provided to prevent sliding.
- Edge zone: The installer must always keep the minimum edge zone free as described in the applicable standard(s). An example of such a standard is the NEN7250, but this is not exhaustive.
- Installers must always provide sufficient ballast depending on the situation. In case of doubt, please contact a specialised consultancy/engineering bureau.
- It is the installer's responsibility to check if the panels can be clamped in the manner (on the short or long side, position of the clamps, etc.) as provided in this manual. If this is not the case, Avasco Solar can in no way be held responsible for any damage, in whatever form.
- Avasco Solar nv can never be held liable if materials are used for assembly that are not supplied by Avasco Solar nv.
- The warranty conditions with regard to the assembly frames of Avasco Solar nv are available upon request. Failure to strictly follow the assembly instructions will void all warranty.
- The installer is responsible for the use of the necessary PPE.
- Avasco Solar nv reserves the right to change the assembly instructions at any time. It is the installer's responsibility to always follow the latest version, which is the only valid one. This is available at all times on the website [www.avasco-solar.be](http://www.avasco-solar.be) or can be obtained upon request.



**avasco  
solar**



## **100% belgian made**

SolarSpeed is manufactured from A to Z at our production site in Ypres. As a result, we are always in control of the quality of our products, throughout the entire production process. This local production under our own management also ensures that we can respond to market demands in an extremely flexible way. The standards that are applied at all times are those of our quality management system, ISO 9001.



## **on-site delivery**

We always have a large number of mounting frames in stock in our warehouse. This allows us to continue to guarantee short delivery times, even for your industrial projects. If desired, we can also deliver the materials directly to the site, both domestically and abroad.



**Avasco Solar nv**  
**Rodenbachstraat 53**  
**8908 Vlamertinge - Belgium**  
**T +32 (0)57 27 15 00**  
**VAT BE 0721.474.320**  
**info@avasco-solar.be**  
**www.avasco-solar.be**

**solar  
mounting  
frames**